

REPORT OF CONCRETE CYLINDER TEST

MAPPA TESTLAB

1956 Richardson Hwy, North Pole, AK

Report Date: 6/25/26

Project Number: Heritage M2C1 JV Ile De France Report Number: 1

Project: Ile De France

Client: Heritage M2C1 JV

Address: P.O. Box 1229

Delta Junction, AK 99737

Attn:

FIELD TEST CONDITIONS AND RESULTS (ASTM C 31)

Date Placed: 5/28/2026

Time Sampled: 9AM

Location of Sample: Curb

Supplier: URM

Truck Number:

Ticket Number: 110493

Mix Number: 253440IN

Design Strength: 4000

Batch Size:

Slump: 4" (ASTM C 143)

Air Content: 5.5% (ASTM C 231)

Concrete Temp: 58 °F (ASTM C 1064)

Ambient Temp: 53 °F

Water Added:

Technician: Markus Mack

Initial Curing:

Final Curing:

Max Field Curing Temp.:


Min Field Curing Temp.:

LABORATORY TEST RESULTS (ASTM C 39)

Specimen	Test Date	Age	Load	Diameter	Area	Strength	Percent of Design	Type of Fracture
26-393	6/4/2026	7	49330	4.00	12.57	3930	98%	3
26-394	6/11/2026	14	57875	4.00	12.57	4610	115%	3
26-395	6/25/2026	28	66645	4.00	12.57	5300	133%	3
26-396	6/25/2026	28	67730	4.00	12.57	5390	135%	3
26-397	6/25/2026	28	63065	4.00	12.57	5020	126%	3

Remarks:

Copies to:

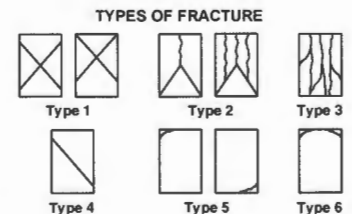

Reported by:

Chris Mack, C.E.T.
Concrete Lab Supervisor