

REPORT OF CONCRETE CYLINDER TEST

MAPPA TESTLAB

1956 Richardson Hwy, North Pole, AK

Report Date: 7/30/26

Project Number: Heritage M2C1 JV Ile De France Report Number: 1

Project: Ile De France

Client: Heritage M2C1 JV

Address: P.O. Box 1229

Delta Junction, AK 99737

Attn:

FIELD TEST CONDITIONS AND RESULTS (ASTM C 31)

Date Placed: 7/1/2026

Time Sampled: 8am

Location of Sample: South Curb

Supplier: URM

Truck Number:

Ticket Number: 111081

Mix Number: 253445AI

Design Strength: 4500

Batch Size:

Slump: 5.50" (ASTM C 143)

Air Content: 5.4% (ASTM C 231)

Unit Weight: 146.54 (ASTM C 138)

Concrete Temp: 60°F (ASTM C 1064)

Ambient Temp: 65°F

Water Added:

Technician: Ben Marth

Initial Curing:

Final Curing:

Max Field Curing Temp.:

Min Field Curing Temp.:


LABORATORY TEST RESULTS (ASTM C 39)

Specimen	Test Date	Age	Load	Diameter	Area	Strength	Percent of Design	Type of Fracture
26-1094	7/8/2026	7	55355	4.00	12.57	4410	98%	3
26-1095	7/8/2026	7	56015	4.00	12.57	4460	99%	3
26-1096	7/29/2026	28	70360	4.00	12.57	5600	124%	3
26-1097	7/29/2026	28	69550	4.00	12.57	5530	123%	3
26-1098	7/29/2026	28	70285	4.00	12.57	5590	124%	3

Remarks:

Copies to:

TYPES OF FRACTURE

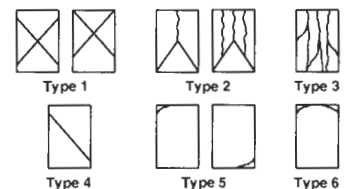

Reported by:

Chris Mack

Chris Mack, C.E.T.

Concrete Lab Supervisor